



MHZ VORTAC	APP CRS	Rwy Idg	8500
113.2	175°	TDZE	320
Chan 79		Apt Elev	346

VOR/DME or TACAN RWY 16R

JACKSON-MEDGAR WILEY EVERS INTL (JAN)

VDP NA with Hawkins Fld altimeter setting. When local altimeter setting not received, use Hawkins Fld altimeter setting and increase all MDA 20 feet; increase S-16R Cats C/D/E visibility ½ mile. Circling NA for Cat E SW of Rwy 16R-34L. Helicopter visibility reduction below ¾ SM NA. MISSED APPROACH: Climbing left turn to 3000 on heading 103° and MHZ VORTAC R-134 to RAKIN INT/ MHZ 16.5 DME and hold.

ATIS 121.05	JACKSON APP CON★ 123.9 317.7	JACKSON TOWER★ 120.9 (CTAF) 352.0	GND CON 121.7 348.6	UNICOM 122.95
----------------	---------------------------------	--------------------------------------	------------------------	------------------

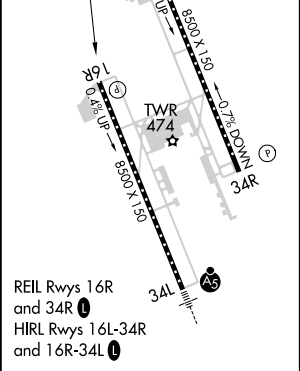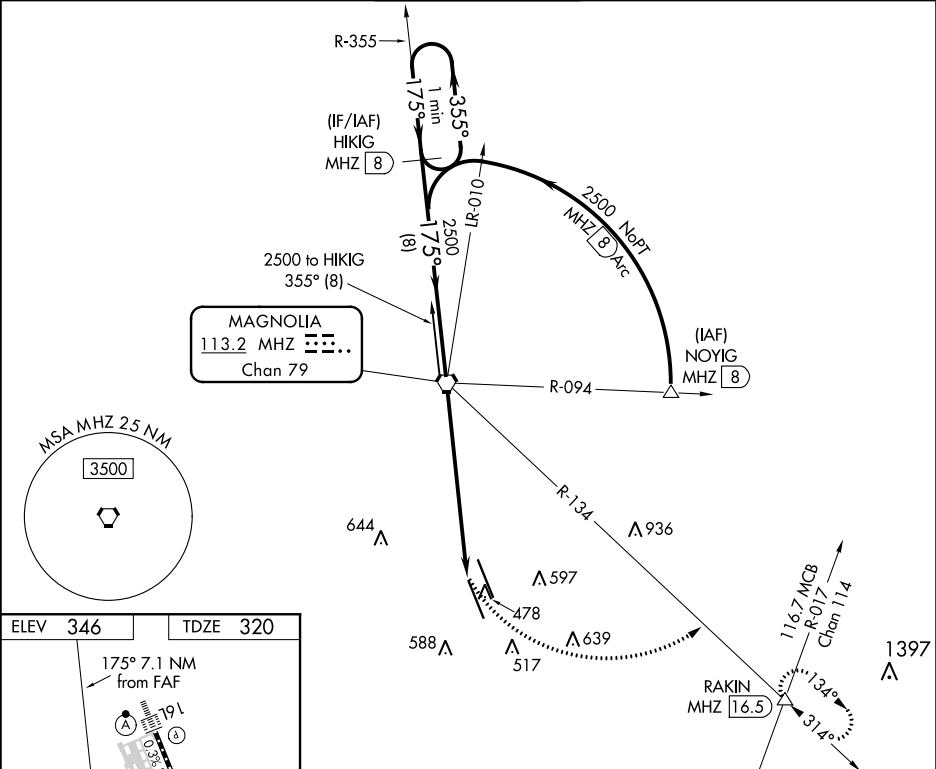

VGSI and descent angles not coincident (VGSI Angle 3.00/TCH 80).				
One Minute Holding Pattern				
HIKIG MHZ 8				
MHZ VORTAC				
3000 hdg 103°				
MHZ R-134				
RAKIN				
2500 355° 175° 2500 175° 2500 2.83° TCH 55				
8 NM 5.5 NM 1.6				
CATEGORY	A	B	C	D
S-16R	880-1	560 (600-1)	880-1½	560 (600-1½)
CIRCLING	880-1	900-1	900-1½	960-2
	534 (600-1)	554 (600-1)	614 (700-2)	694 (700-2½)