

WAAS CH 90110 W07A	APP CRS 076°	Rwy Idg TDZE 5502 Apt Elev 5507
--	------------------------	---

RNAV (GPS) RWY 7

FOUR CORNERS RGNL (FMN)

RNP APCH-GPS.


▼

▲

Baro-VNAV and VDP NA when using Durango altimeter setting. For uncompensated Baro-VNAV systems, LNAV/VNAV NA below -25°C or above 54°C. Circling NA for Cat D southeast of Rwy 5 and south of Rwy 25. When local altimeter setting not received, use Durango altimeter setting and increase LPV DA to 6003 feet and LNAV/VNAV DA to 6223 and all visibilities $\frac{5}{8}$ SM; increase all MDAs 260 feet and visibility LNAV Cats B/C/D and Circling Cats A/B/C $\frac{5}{8}$ SM.

MISSED APPROACH:
Climb to 8300 direct
CODEN and hold.

ATIS 127.15	DENVER CENTER 118.575 348.7	FARMINGTON TOWER* 118.9 (CTAF) 257.8	GND CON 121.7	UNICOM 122.95
-----------------------	---------------------------------------	---	-------------------------	-------------------------

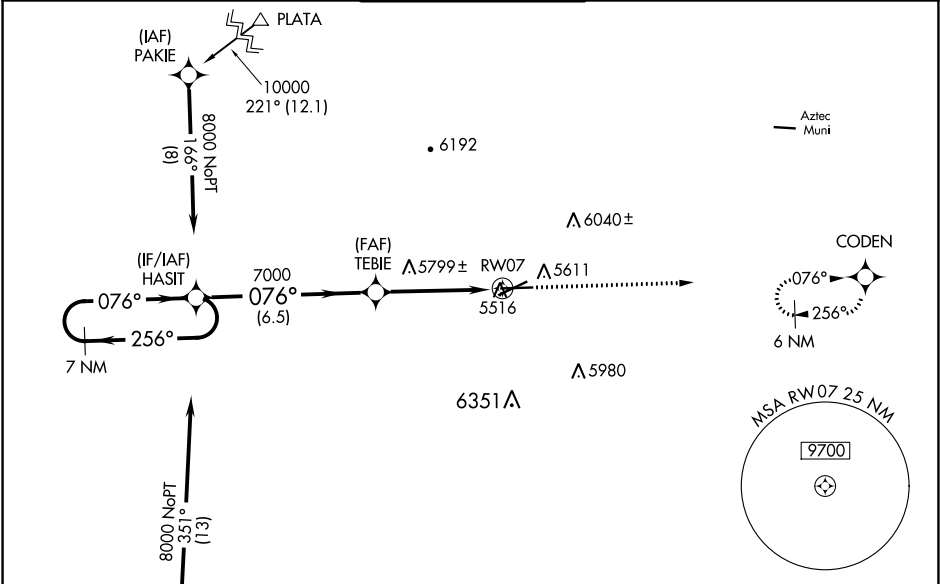

ELEV 5507 **D** TDZE 5502

7 NM Holding Pattern

8000

GP 3.00° TCH 52

HASIT

TEBIE

RW07

8300

CODEN

*1.7 NM to RW07

*LNAV only

6.5 NM

2.9 NM

1.7 NM

CATEGORY	A	B	C	D
LPV DA	5760-3/4		258 (300-3/4)	
LNAV/VNAV DA	5980-13/8		478 (500-13/8)	
LNAV MDA	6060-1	558 (600-1)	6060-15/8	558 (600-15/8)
CIRCLING	6100-1 593 (600-1)	6180-1 673 (700-1)	6380-21/2 873 (900-21/2)	6460-3 953 (1000-3)

REIL Rwy 23 and 25

MIRL Rwy 5-23 and 7-25